

Single Survey

survey report on:

Property address	KELLBROOK AIRYHEMMING GLENLUCE, NEWTON STEWART, DG8 0NP
-------------------------	---

Customer	Stuart Adams
-----------------	--------------

Customer address	
-------------------------	--

Prepared by	DM Hall LLP
--------------------	-------------

Date of inspection	5th March 2024
---------------------------	----------------



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a detached two storey villa.
Accommodation	GROUND FLOOR : Lounge, dining room, kitchen/dining area, games room, cloakroom, boiler room. FIRST FLOOR : Two landings, four bedrooms, bathroom, shower room.
Gross internal floor area (m²)	184 or thereby.
Neighbourhood and location	The property is located in a sparsely populated rural setting approximately 2.5 miles from Glenluce where local facilities and amenities are available. Wider range of facilities and amenities are available in nearby Newton Stewart and Stranraer.
Age	Approximately 75 years (unconfirmed).
Weather	Wet and overcast, following a period of unsettled weather conditions.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. Brick construction with a pointed finish. Adjacent flashings appear to be formed in lead material.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Single Survey

Roofing including roof space	<p>The roof is pitched and overlaid with slates. The roof structure contains valley gutters.</p> <p>I was able to inspect the roof space and gained access from hatches within the first floor landings. The roof is built of timber trusses and boarded over with sarking material. Insulation material is laid between the ceiling joists.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Rainwater units are of PVC and cast iron materials, consisting of half round gutters discharging into round downpipes.</p>
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The walls appear to be of cavity brick construction with an external finish of render. There are sub- floor ventilators fitted.</p>
Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Windows and external doors are of uPVC double glazed type.</p>
External decorations	<p>Visually inspected.</p> <p>External decoration has a painted finish.</p>
Conservatories / porches	<p>None.</p>
Communal areas	<p>None.</p>
Garages and permanent outbuildings	<p>Visually inspected.</p> <p>Two brick built garden stores with a pitched and slate roof covering.</p>
Outside areas and boundaries	<p>Visually inspected.</p> <p>There are garden grounds surrounding the property, these generally being laid out in grass and concrete paving. Boundary divisions are marked by timber fencing and stone walls. There is a woodland section to the front of the garden.</p>

Single Survey


Ceilings	Visually inspected from floor level. Ceilings are of plasterboard material.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Internal walls are of masonry construction finished in plaster. There are tiled and PVC wall finishes.
Floors including sub floors	The floors are of suspended timber construction. I was unable to inspect the sub floor areas.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Internal joinery is of timber and there are timber internal doors. The kitchen contains floor and wall mounted storage units.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. There is an open fire within the lounge. Other original fireplaces have been removed.
Internal decorations	Visually inspected. Internal decorative finishes are generally papered or painted.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Assumed mains supply. The electrical switchgear is located in a cupboard within the entrance hallway.

Single Survey

Gas	None.
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Assumed mains water supply. Visible sections of pipework are of copper and PVC materials.</p> <p>Sanitary fittings in the bathroom comprise a white suite with low level w.c., wash hand basin and bath.</p> <p>Sanitary fittings in the shower room comprise a white suite with low level w.c., wash hand basin and shower cabinet.</p> <p>There is a sink unit within the kitchen.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a "Heatrae Sadia" wall mounted electric heating boiler within the boiler room. This serves water filled steel panelled radiators throughout the house and it also provides domestic hot water. This fixed to a hot water storage tanks also located within the boiler room.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is understood to be connected to a septic tank located out with the property boundary.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Smoke alarms fitted.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p>

Any additional limits to inspection	<p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</p> <p>The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.</p> <p>Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.</p> <p>My physical inspection of the roof void area was restricted due to insulation material and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.</p> <p>My inspection of the roof covering was restricted from ground level and some parts were not visible.</p> <p>I was not able to inspect the sub floor area.</p> <p>Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</p> <p>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.</p> <p>The woodland and boundaries were not fully inspected at the time of the survey. Titles have not been checked and the land has not been measured.</p>
--	---

Sectional Diagram showing elements of a typical house

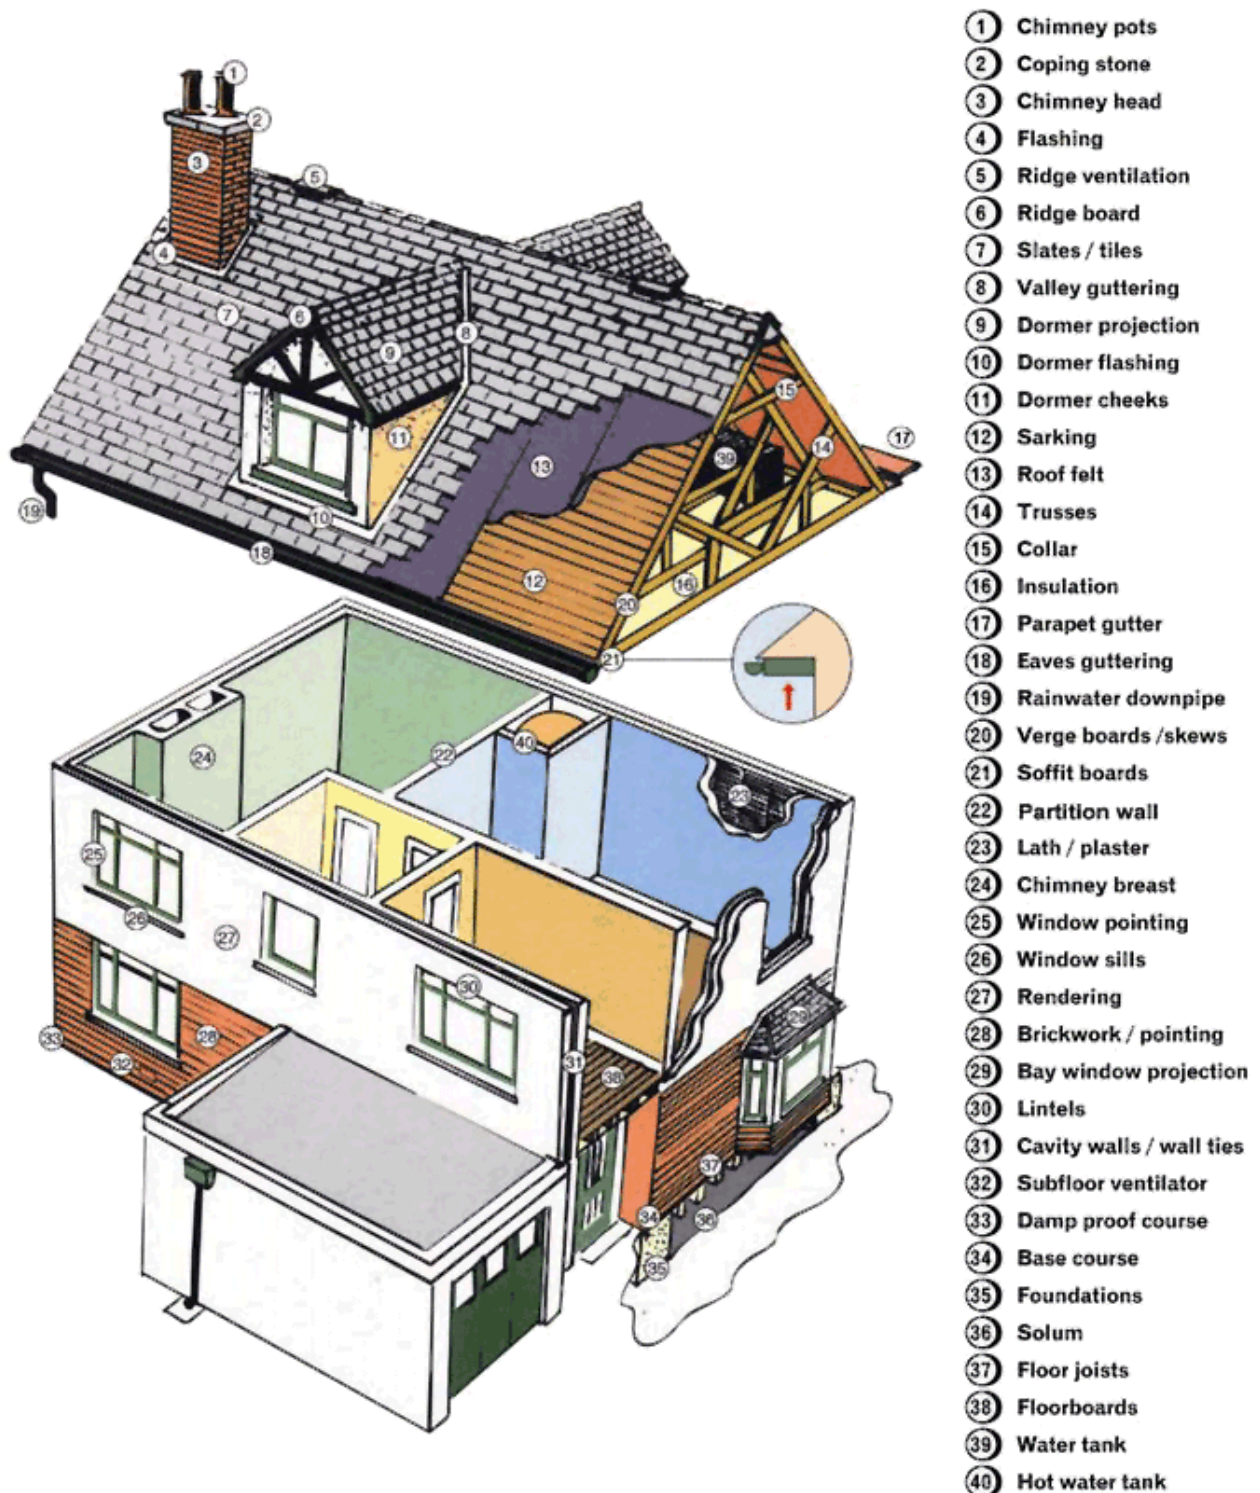


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

 Dampness, rot and infestation	
Repair category	2
Notes	There is evidence of wood boring insect infestation to the timbers within the roof space. This can be treated by a timber/specialist contractor.

 Chimney stacks	
Repair category	2
Notes	<p>The chimney stack appears to be constructed of original materials and deterioration is noted.</p> <p>Chimneys, particularly of older properties, can be a source of water penetration and defects to rendering, mortar and flashings can be difficult to detect from a ground level inspection. These will require to be maintained in good repair to discourage water penetration. It is good practice to engage a reputable roofing or building contractor prior to purchase to advise on life expectancy and repair/replacement costs.</p>

 Roofing including roof space	
Repair category	2
Notes	There are a number of chipped and slipped roof slates and moss growth is noted. A reputable roofing contractor can be asked to inspect the roof structure to advise on all necessary repairs to ensure wind and water tightness. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original. Regular maintenance is anticipated until replacement.



Roofing including roof space

Repair category	2
Notes	<p>There are valley gutters. These can be problematic especially within older buildings, and maintenance should be undertaken regularly.</p> <p>There is evidence of condensation in the roof space. This may be alleviated through improved loft ventilation. A firm of damp specialists/roofing contractors will be able to provide further advice.</p> <p>There is evidence of wood boring insect infestation to the timbers within the roof space. See 'Dampness, rot and infestation' section above.</p>



Rainwater fittings

Repair category	2
Notes	Sections of gutters are damaged/insecure.



Main walls

Repair category	2
Notes	There is evidence of cracked render to the external walls.



Windows, external doors and joinery

Repair category	2
Notes	<p>The window units and external doors are of an older type and wear and tear is noted. Repair/replacement in the medium term should be anticipated. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.</p> <p>Windows units/ access doors have been replaced in the past. Random windows and doors are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p>



External decorations

Repair category	1
Notes	No significant defects evident.



Conservatories/porches

Repair category	-
Notes	None.



Communal areas

Repair category	-
Notes	None.



Garages and permanent outbuildings

Repair category	2
Notes	Elevated moisture readings were recorded to internal surfaces with the garden stores. Regular maintenance should be anticipated.



Outside areas and boundaries

Repair category	2
Notes	Concrete hard-standing areas are damaged in areas and repairs are required. There are mature trees growing within influencing distance of the house. A tree surgeon will be able to provide further advice. Garden boundaries should be confirmed.



Ceilings

Repair category	1
Notes	There is plaster cracking to some ceiling surfaces. There is damp staining to some ceiling surfaces. The staining appears to be dry and should be closely monitored.



Internal walls

Repair category	1
Notes	No significant defects evident.



Floors including sub-floors

Repair category	1
Notes	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.



Internal joinery and kitchen fittings

Repair category	1
Notes	No significant defects evident.



Chimney breasts and fireplaces

Repair category	1
Notes	Flues should ideally be swept and tested on an annual basis. Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented.



Internal decorations

Repair category	2
Notes	Internal decorative finishes are stained/marked in places. The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.



Cellars

Repair category	-
Notes	None.

Single Survey



Electricity

Repair category	2
Notes	<p>The electrical installation is dated as the electrical consumer unit is of an older type and there is a limited supply of electrical sockets, some of which are of an older design. Further advice will be available from a NICEIC/SELECT registered electrician.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.</p>



Gas

Repair category	-
Notes	None.



Water, plumbing and bathroom fittings

Repair category	1
Notes	Seals around the bath and shower areas are frequently troublesome. Failure to seals can result in dampness/decay within hidden areas of the property.



Heating and hot water

Repair category	1
Notes	<p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>Boilers and central heating systems should be tested and serviced by a registered engineer on an annual basis to ensure their safe and efficient operation.</p>



Drainage

Repair category	1
Notes	The owner has not been able to provide any information about the septic tank maintenance and it is assumed that the tank is registered with SEPA. Regular inspection and maintenance should be anticipated.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	-
Electricity	2
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is understood that the property was converted from two semi detached properties to a single dwelling, possibly circa 2004. French doors have also been added within the games room circa 2022. I have assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then I have assumed that they meet the standards required by the Building Regulations or are exempt.

Drainage is advised to be to a private septic tank. The system has not been checked and condition, legal and environmental issues have not been investigated. For the purposes of the report, all are assumed to be satisfactory.

Reference to the Title will confirm extent of garden ground and maintenance responsibility of boundaries. The report assumes that maintenance is on a shared and equitable basis.

Reference to the Title will confirm whether parking adjacent to the dwelling between enclosed garden and road is available as parking for the property.

Estimated reinstatement cost for insurance purposes

£410,000 (Four Hundred and Ten Thousand Pounds).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments

£340,000 (Three Hundred and Forty Thousand Pounds).

The reported valuation is a snapshot in time and reflects the prevailing market conditions. The market is presently characterised by generally stable conditions and a return to more normal levels of supply and demand.

Signed

Security Print Code [537686 = 6335]
Electronically signed

Report author

Mark Rutherford

Company name

DM Hall LLP

Single Survey

Address	11 Buccleuch Street, Dumfries, DG1 2AT
Date of report	4th April 2024

Mortgage Valuation Report



Property Address

Address KELLBROOK AIRYHEMMING GLENLUCE, NEWTON STEWART, DG8 0NP
Seller's Name Stuart Adams
Date of Inspection 5th March 2024

Property Details

Property Type House Bungalow Chalet Purpose built maisonette
 Coach Studio Converted maisonette Purpose built flat
 Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

Two brick gardens stores.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame
 Solid Cavity Steel frame Concrete block Other (specify in General Remarks)

Roof Tile Slate Asphalt Felt
 Lead Zinc Artificial slate Flat glass fibre Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No
If Yes, is this recent or progressive? Yes No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No
If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None
Electricity Mains Private None
Central Heating Yes Partial None

Water Mains Private None
Gas Mains Private None

Brief description of Central Heating:

Electric boiler to radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Agricultural land included with property Ill-defined boundaries Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

When inspected the property was unoccupied, furnished and floors were covered. Generally the subjects were found to be in fair condition having regard to age and style of construction. No obvious significant defects which would affect value or security were in evidence.

It is understood that the property was converted from two semi detached properties to a single dwelling, possibly circa 2004. French doors have also been added within the games room circa 2022. I have assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then I have assumed that they meet the standards required by the Building Regulations or are exempt.

Drainage is advised to be to a private septic tank. The system has not been checked and condition, legal and environmental issues have not been investigated. For the purposes of the report, all are assumed to be satisfactory.

Reference to the Title will confirm extent of garden ground and maintenance responsibility of boundaries. The report assumes that maintenance is on a shared and equitable basis.

Reference to the Title will confirm whether parking adjacent to the dwelling between enclosed garden and road is available as parking for the property.

Essential Repairs

No essential repairs required.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property forms suitable security for mortgage purposes, subject to individual lending criteria.

Valuations

Market value in present condition	£	<input type="text" value="340,000"/>
Market value on completion of essential repairs	£	<input type="text" value="--"/>
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£	<input type="text" value="410,000"/>
Is a reinspection necessary?		<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£	<input type="text" value="--"/>
Is the property in an area where there is a steady demand for rented accommodation of this type?		<input type="checkbox"/> Yes <input type="checkbox"/> No

Declaration

Signed	Security Print Code [537686 = 6335] Electronically signed by:-
Surveyor's name	Mark Rutherford
Professional qualifications	MA (Hons) MRICS
Company name	DM Hall LLP
Address	11 Buccleuch Street, Dumfries, DG1 2AT
Telephone	01387 454318
Fax	01387 250498
Report date	4th April 2024